


Monthly Compliance Report

April 2026**Velocity Tower - Sheffield**
Mason Owen

10 St Mary's Gate, Sheffield, S1 4LR

Velocity Tower
St Mary's Gate, Sheffield**100%**PPM COMPLETED
ON TIME**4 / 4**FIRE ALARM TEST
CERTIFICATES SUPPLIED**0**PPM ITEMS NOT
ON TIME**COMPLIANT**MONTHLY PPM
POSITION**PPM Performance**

Monthly planner activity against completion.

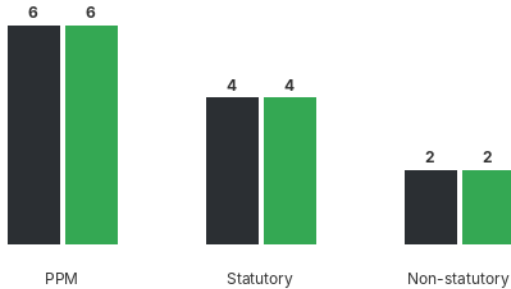**Fire Alarm Weekly Test Summary**

4 Metro certificates supplied for this month.

- 01 Apr 2026** Action recorded
ARC signal issue recorded on current visit
- 07 Apr 2026** Satisfactory
No new issues
- 14 Apr 2026** Satisfactory
No new issues
- 23 Apr 2026** Satisfactory
No new issues

Compliance Overview

Total planned tasks: 12
Completed on time: 12
Not on time: 0
Fire certificates: 4

Key Updates This Month

- All planned PPM tasks completed.
- No Evotech PPM carryover at month end.
- Hydraclean water sample results received.
- Original evidence retained for audit.

Next Month - Look Ahead

Continue planned maintenance, compliance checks and weekly fire alarm evidence capture.

Any Questions?

Please contact your Evotech Account Manager or Helpdesk.

02 Maintenance & PPM Performance

The monthly planner information is presented below in a simplified format for portal users. The signed engineer report remains in the evidence section.

Category	Due	Completed	Open	Missed	Attended on time	Completed on time
PPM	6	6	0	0	6	6
Statutory	4	4	0	0	4	4
Non-statutory	2	2	0	0	2	2

PPM activities completed

Activity	Frequency	Location	Completion date	Status
Emergency lighting	Monthly	Common areas	15 Apr 2026	Complete
General lighting	Monthly	Common areas	15 Apr 2026	Complete
Disabled toilet alarm operational test	Monthly	Common areas	15 Apr 2026	Complete
Hot & cold water temperature monitoring	Monthly	Common areas	15 Apr 2026	Complete
TMV checks	Annual	Common areas	15 Apr 2026	Complete
Cold water booster set visual checks	Planned	Water tank room	15 Apr 2026	Complete

Monthly position

All PPM tasks shown in the April source report were completed and up to date. There was no Evotech PPM carryover recorded at month end. Hydraclean water sample results taken on 13 March had also been received.

03 Compliance Summary

Area	Activity	April evidence	Position	Comment
Fire alarm	Weekly user test	Metro - 4 certificates	See weekly summary	Current visit outcomes reported below
Emergency lighting	Monthly / annual check	Evotech source pack	See evidence	Original record retained
Water hygiene	Temperature monitoring	Evotech source pack	See evidence	Original record retained
PPM delivery	Monthly planner	Evotech monthly report	12 of 12 on time	Source planner position
Specialist systems	Subcontractor evidence	Original source pack	See evidence	Specialist contractor evidence contained within the ori

Specialist documentation

Specialist contractor evidence contained within the original April source pack is retained in Appendix A.

Evidence approach

Original signed Evotech records and specialist contractor documentation from the source monthly report are reproduced in Appendix A without alteration so the portal issue retains the full audit trail.

04 Weekly Fire Alarm Test Summary

This section records the outcome of each weekly Metro certificate supplied for April. Historic case references carried forward on Metro paperwork are not treated as repeat monthly failures unless the current visit itself records a new issue or an unsuccessful test.

Date	Current visit status	Client-facing note	Evidence
01 Apr 2026	Action recorded	ARC signal issue recorded on current visit	Original Metro certificate retained
07 Apr 2026	Satisfactory	No new issues	Original Metro certificate retained
14 Apr 2026	Satisfactory	No new issues	Original Metro certificate retained
23 Apr 2026	Satisfactory	No new issues	Original Metro certificate retained

Reporting note

4 Metro weekly fire alarm certificates have been supplied for April 2026. The table above reports the current-visit position shown on each certificate. Historic case references remain visible in Appendix B for audit traceability but are not treated as repeat failures unless the current visit itself records the issue.

05 Evidence Register

The following original records are retained within this report so that the portal document remains suitable for management review and audit evidence.

Evidence	Date	Source	Location in report
Original monthly PPM / engineer evidence	April 2026	Evotech	Appendix A
Water hygiene / emergency lighting evidence	April 2026	Evotech	Appendix A
Specialist contractor documentation	April 2026	Original source pack	Appendix A
Weekly fire alarm test	01 Apr 2026	Metro Safety	Appendix B
Weekly fire alarm test	07 Apr 2026	Metro Safety	Appendix B
Weekly fire alarm test	14 Apr 2026	Metro Safety	Appendix B
Weekly fire alarm test	23 Apr 2026	Metro Safety	Appendix B

Next month - look ahead

- Continue planned maintenance and monthly compliance checks in line with the planner.
- Continue weekly fire alarm testing and retain each current certificate in the portal pack.
- Include specialist contractor documentation where attendance occurs during the reporting month.

Client contact

Account Manager: Roberto Varela | Helpdesk: helpdesknorth@evotech.co.uk | 01422 377541

APPENDIX A Original April 2026 Compliance Evidence

The following pages reproduce the evidence section of the original monthly report so the redesigned portal document preserves the underlying audit trail.

APPENDIX A Original monthly report evidence - source page 7

Original Evotech / specialist evidence

ENGINEERS CALL OUT REPORT



1 Work Details

CLIENT: Sheffield One (UK) Ltd
Velocity Tower

SITE ADDRESS: St Mary's Gate
Sheffield
S1 4LR

SSRA NUMBER: ORIGINAL: ☐ REVIEWED: ☐

EXPENSES: ☐ NO ☐ PERSONS: ☐

START TRAVEL: 06:37 ON SITE: 07:31 OFF SITE: 15:22 FINISH TRAVEL:

JOB COMPLETED: ☒ YES ☐ NO

Job No: Z03105/149 PPM / WEEK No:

Quote No:

Date: 1 5 0 4 2 6

MON TUE WED THU FRI SAT SUN

DAY (Mk): ☐ ☐ ☒ ☐ ☐ ☐ ☐

2 Description of Works Carried Out

Please indicate the type of work (tick all that apply) and ensure that you complete the relevant Compliance section and appropriate Certification.

Please PRINT clearly:

April PPM's:
Emergency lighting
General lighting
Disabled toilet alarm operational test
Hot and cold water monthly temps
TMV's
Cold water booster set visual checks

ELECT ☐ MECH ☐ GAS ☐ WATER ☐ AC ☐ OTHER ☐

2.1 Compliance

GAS SAFE YES NO

FLUE OK: ☐

VENTILATION OK: ☐

GAS RATE OK: ☐

APPLIANCE SAFE: ☐

Certificates/Notices issued (type/ref):

NICEIC - Installation details

Method of fault protection:

System of earthing arrangement

TN-C-S ☐

TN-S ☐

TT ☐

Protective device for the modified circuit

Type: Rating: A

Essential Tests

Earth continuity satisfactory: ☐

Insulation resistance:

Live - Live: MΩ

Live - Earth: MΩ

Earth fault loop impedance: Ω

Polarity satisfactory: ☐

RCD operation (if applicable)

IΔn Disconnection Time (ms)

Device Rating (mA) X1 X5

Satisfactory test button operation: ☐

F-GAS

System Register completed (NA): ☐

Cylinder Register completed (NA): ☐

Leak Test completed (NA): ☐

CONTINUATION SHEETS: Sheet Numbers:

3 Purchase Orders, Materials & Further Actions

ACTION REQUIRED BY OFFICE (Please tick): YES NO

SMALL WORKS QUOTATION FORM NUMBER:

CLIENT

SIGNATURE: 

PRINT NAME:

ENGINEER

SIGNATURE: 

PRINT NAME: Vytautas Serksnas

OFFICE USE ONLY

ACTION REQUIRED Y / N

MATERIALS ORDERED Y / N

QUOTATION NUMBER Q

DATE

MANAGER

APPENDIX A Original monthly report evidence - source page 8

Original Evotech / specialist evidence



Water Temperature Checks

Contract: <i>Sheffield One</i>	Date: <i>15-04-26</i>
Site: <i>Velocity Tower</i>	Engineer: <i>V. Seekings</i>

MONTHLY TASKS			ADDITIONAL MONTHLY TASKS		
Sentinel Tap Temperatures - nearest & furthest from heat source or CWST.	Cold ($<20^{\circ}\text{C}$)	Hot ($>50^{\circ}\text{C}$)	CWST Temperatures (should be $<20^{\circ}\text{C}$)	At Ball Valve	Opposite Ball Valve
Location:			CWST 1	<i>10.3</i>	<i>10.9</i>
Location:			CWST 2	<i>10.2</i>	<i>10.8</i>
Other outlets; 1 per zone or floor. Check different outlets at each visit.	Cold ($<20^{\circ}\text{C}$)	Hot ($>50^{\circ}\text{C}$)	Cold Water Mains Inlet Temperature	°C	
Location: <i>Easy access</i>	<i>12.7</i>	<i>38.7</i>	Notes:		
Location: <i>Staff kitchen</i>	<i>12.6</i>	<i>59.0</i>			
Location: <i>Staff WC</i>	<i>12.6</i>	<i>59.3</i>			
Location: <i>Reception WC</i>	<i>12.5</i>	<i>59.1</i>			
Location: <i>Reception kitchen</i>	<i>12.5</i>	<i>59.2</i>			
Location: <i>Boston bib</i>	<i>12.5</i>	<i>-</i>			
Location: <i>Boston sink</i>	<i>12.6</i>	<i>58.8</i>			
Location:					
Location:					
Showers; de-scale and disinfect	Every 3 Months		ADDITIONAL ANNUAL TASKS (See relevant form for CWST Inspection)		
Location:			Notes:		
Location:					
Location:					
Location:					
Location:					
Calorifiers:	Return $>50^{\circ}\text{C}$	Flow $>60^{\circ}\text{C}$	Notes:		
Calorifier 1 Temperatures:					
Calorifier 2 Temperatures:					

COLD WATER AT EACH OUTLET SHOULD BE LESS THAN 20°C WITHIN 2 MINUTES
HOT WATER AT EACH OUTLET SHOULD BE AT LEAST 50°C WITHIN 1 MINUTE
If TMVs fitted to any outlet, readings to be taken upstream of valve using surface temperature probe
Recommended sign to be used if outlet temperature exceeds 45°C
Weekly flushing of little-used outlets may be required at some locations

Page 1 of 1


Document Ref: 43-01 (V1)

APPENDIX A Original monthly report evidence - source page 9

Original Evotech / specialist evidence

2026

Cold Water Storage Tank Inspection Check Sheet



Six Monthly Annual Internal Inspection	Perform storage, flow and return temperature 18 requires the internal surfaces to be clean & shiny										Parameters			Temperature should be less than 20°C Stored water should be no more than 2°C above the mains supply											
Cold Water Storage Tank ID	JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC	
Six Monthly Storage Temperature	8	8.4	8.4	8.5	10.3	10.8																			
Six Monthly Ball Valve Inlet Temperature	2	2	2	2	2	2																			
Date: 06/01		06/02		04/3	15/4																				
Signature: V/S	V/S		30	V/S																					

	JAN	FEB	MAR	APR	MAY	JUN	JUL	AUG	SEP	OCT	NOV	DEC
Annual Internal Inspection Clearances Comments (see reports sheet if necessary)												
Do the Internal walls feel shiny? Y / N												
Are the internal surfaces clean and shiny? Y / N												
Date:												
Signature:												
Cold water storage tank deep cleaned & disinfectant? (see and when required)												
Date:												
Signature:												

Page 1 of 1

Document Ref: 35-01 (V1)

[illegible]

APPENDIX A Original monthly report evidence - source page 10

Original Evotech / specialist evidence



Emergency Light Maintenance Record

Emergency Lighting Inspection and Test Certificate
For systems designed to BS 5266-1 and BS EN 50172/BS 5266-8
WARNING:
 Full duration tests involve discharging the batteries, so the emergency lighting system will not be fully functional until the batteries have had time to recharge. For this reason, all tests should be undertaken at times of minimum risk. Alternatively, suitable temporary arrangements should be made until the batteries have been recharged.

Contract No:	PPM No:	Region: <i>NIE</i>
Site Details: <i>Velocity Tower Sheffield</i>		

Details of System: (Complete location page 2)	Date of first test:
Date the system commissioned: <i>N/A</i>	Duration of system: <i>3</i> Hours Automatic Test System fitted? ☐ Yes ☒ No

State additions or modifications to the system or the premises since original installation	
Date	Addition or modification

Engineer's Name	Date of Test	Test Type (delete as applicable)	TEST RESULTS	
			PASSED ~ Sign below ~	FAILED ~ Sign below ~
<i>V. Seekings</i>	<i>21/11/25</i>	<i>Monthly</i>	<i>Pass</i>	
<i>V. Seekings</i>	<i>19/12/25</i>	<i>Monthly</i>	<i>Pass</i>	
<i>V. Seekings</i>	<i>08/01/26</i>	<i>Monthly</i>	<i>Pass</i>	
<i>V. Seekings</i>	<i>10/02/26</i>	<i>Monthly</i>	<i>Pass</i>	
<i>J. DAVITT</i>	<i>4/3/26</i>	<i>Monthly</i>	<i>Pass</i>	
<i>V. Seekings</i>	<i>15/4/26</i>	<i>Monthly</i>	<i>Pass</i>	
		Monthly		
		Monthly		

*Sign as applicable. ALL Failures MUST be recorded on Page 3

Site / Area / Building Number

Document Ref: 25-02
Page 1 of 3
Issue Date: 25/09/2015

4. Specialist documentation (Sub contractor)

Version 1.0

Page 10

APPENDIX A Original monthly report evidence - source page 11

Original Evotech / specialist evidence

211174

WORK REPORT
Issued By:

 **HYDRACLEAN**

HYDRACLEAN LTD
UNIT 7
CROMWELL ROAD
BREDBURY
SK6 2RF
TEL: 0161 430 5100

Client: **Evotech (Evolution Technical Services Ltd)** Date: **13 March 2026**
Address: **Velocity Tower, St Mary's Gate, Sheffield, S1 4LR** Site/Job information:
Site ID: 1993
User Code:
Contract number:
Time scheduled for job:

Customer contact: **helpdesknorth@evotech.co.uk** Time in: **08:00**
Time out: **08:15**

Reason for visit:

SPECIFIC TASKS

3 monthly full potable sampling from 2x random cold water outlets -- COMPLETED
3 monthly Legionella sampling from 2x random hot water outlets -- COMPLETED

REASON FOR ANY NON-COMPLETE TASKS:

Comments:
key safe access code 1471

Faults found:
No faults found.

Client Signature: _____ Engineer Signature: 

Name: **no staff present to sign** Name: **Thomas Chappell**

APPENDIX A Original monthly report evidence - source page 12

Original Evotech / specialist evidence

Certificate of Analysis for Legionella			
Issued by:			
 HYDRACLEAN		HYDRACLEAN LTD UNIT 7 CROMWELL ROAD BREDBURY SK6 2RF TEL: 0161 430 5100	
Date sampled: 13 March 2026			
Client: Evotech (Evolution Technical Services Ltd)			
Site: Velocity Tower, St Mary's Gate, Sheffield, S1 4LR			
Site ID: 1993			
System Reference: Communal Kitchen Sink Hot			
System Location: Velocity Tower, St Mary's Gate, Sheffield, S1 4LR (1993)			
Sample No: 1993/L0015			
Sample Type: Hot			
<i>This is to certify that we have undertaken an examination of environmental water samples for the presence of Legionella organisms.</i>			
<i>A sample of water was taken from the above Client's site and the above System and analysed by an independent UKAS accredited testing authority for the presence of Legionella organisms in accordance with current standards.</i>			
RESULTS			
TEST LEGIONELLA SPP.	TEMPERATURE 52.0	PRE / POST FLUSH Pre	RESULT NOT DETECTED
Date Certificate Issued: 27 March 2026			
Issued by: Elizabeth Green			

APPENDIX A Original monthly report evidence - source page 13

Original Evotech / specialist evidence

Certificate of Analysis for Legionella			
Issued by:			
 HYDRACLEAN		HYDRACLEAN LTD UNIT 7 CROMWELL ROAD BREDBURY SK6 2RF TEL: 0161 430 5100	
Date sampled: 13 March 2026			
Client: Evotech (Evolution Technical Services Ltd)			
Site: Velocity Tower, St Mary's Gate, Sheffield, S1 4LR			
Site ID: 1993			
System Reference: Staff Kitchen Sink Hot			
System Location: Velocity Tower, St Mary's Gate, Sheffield, S1 4LR (1993)			
Sample No: 1993/L0016			
Sample Type: Hot			
<i>This is to certify that we have undertaken an examination of environmental water samples for the presence of Legionella organisms.</i>			
<i>A sample of water was taken from the above Client's site and the above System and analysed by an independent UKAS accredited testing authority for the presence of Legionella organisms in accordance with current standards.</i>			
RESULTS			
TEST	TEMPERATURE	PRE / POST FLUSH	RESULT
LEGIONELLA SPP.	58.5	Pre	NOT DETECTED
Date Certificate Issued: 27 March 2026			
Issued by: Elizabeth Green			

APPENDIX B Metro Weekly Fire Alarm Certificates - April 2026

Original Metro certificates follow. Historic case references are retained exactly as supplied for audit traceability.

APPENDIX B Weekly fire alarm test - 01 Apr 2026

Original Metro certificate - page 1 of 2



Visit Report

Fire Alarm Test

00948922 - Wed, 1 Apr 26 12:31 PM

Address
Visit Date
Work Order Number
Inspector
Building Reference

Velocity Tower, 10 St Mary's Gate, Sheffield, S1 4LR
Wed, 1 Apr 26 12:31 PM
00948922
Mr Fisher
Metro: 103352

Survey Results – Actions Required

Question	Result
The Alarm receiving centre received a fire signal.	☒

Survey Results – No Action Required

Question	Result
The Fire Alarm Panel was showing no fault lights and a healthy power supply.	☒
The Break Glass Unit due to be tested was showing no visible signs of damage.	☒
The sounders activated upon testing of the Break Glass Unit.	☒
The correct zone or loop was displayed on the fire panel.	☒
Interfaced panels or systems (i.e. lifts, gas supply) acted in accordance with the correct cause and effect.	☒
The fire panel silenced and reset correctly and was left with no fault lights present.	☒
Any interfaced systems were reset and left in working order.	☒

New Issues Detected

CASE: 00917297 **Date Opened:** Wed, 1 Apr 26
Object Type: Building **Location:**
Subject: The signal from the fire alarm panel to the Alarm Receiving Centre was not received.
Issue Description: The fire service will not be automatically contacted in the event of a fire at this property. In the event of a fire, the fire service will have to be contacted manually in order to raise the alarm.
Next Action: Please contact the relevant maintenance provider to arrange to rectify this issue.
Inspector Comment:

New Issues Images

Case No.	Image
----------	-------

T 020 7960 3939 E enquiries@metrosafety.co.uk W www.metrosafety.co.uk

Company Registration No: 03357802 VAT No: 364104228
Registered Office Address: 2 Dominus Way, Meridian Business Park, Leicester LE19 1RP



APPENDIX B Weekly fire alarm test - 01 Apr 2026

Original Metro certificate - page 2 of 2



Visit Report

Fire Alarm Test

00948922 - Wed, 1 Apr 26 12:31 PM

Existing Cases Redetected

Question	Case No.	Location	Subject	Issue Description	Next Action
----------	----------	----------	---------	-------------------	-------------

No Existing Issues.

Existing Cases Images

Case No.	Image
----------	-------

Tested Asset/s

Asset	Location	Result
Fire Alarm Panel	Common area, ground floor, rear entrance lobby, RHS wall, LHS Panel FAP1	✓
Call Point	Common area, 19th Floor, lift lobby landing CP 19A	✓

T 020 7960 3939 E enquiries@metrosafety.co.uk W www.metrosafety.co.uk

Company Registration No: 03557802 VAT No: 364104228
Registered Office Address: 2 Dominus Way, Meridian Business Park, Leicester LE19 9PF



APPENDIX B Weekly fire alarm test - 07 Apr 2026

Original Metro certificate - page 1 of 2



Visit Report

Fire Alarm Test

00948915 – Tue, 7 Apr 26 10:09 AM

Address
Visit Date
Work Order Number
Inspector
Building Reference

Velocity Tower, 10 St Mary's Gate, Sheffield, S1 4LR
Tue, 7 Apr 26 10:09 AM
00948915
Mr Fisher
Metro: 103352

Survey Results – No Action Required

Question	Result
The Fire Alarm Panel was showing no fault lights and a healthy power supply.	✓
The Break Glass Unit due to be tested was showing no visible signs of damage.	✓
The sounders activated upon testing of the Break Glass Unit.	✓
The correct zone or loop was displayed on the fire panel.	✓
Interfaced panels or systems (i.e. lifts, gas supply) acted in accordance with the correct cause and effect.	✓
The Alarm receiving centre received a fire signal.	✓
The fire panel silenced and reset correctly and was left with no fault lights present.	✓
Any interfaced systems were reset and left in working order.	✓

New Issues Detected

No New Issues.

New Issues Images

Case No.	Image
----------	-------

Existing Cases Redetected

Question	Case No.	Location	Subject	Issue Description	Next Action
----------	----------	----------	---------	-------------------	-------------

No Existing Issues.

Existing Cases Images

Case No.	Image
----------	-------

T 020 7960 3939 E enquiries@metrosafety.co.uk W www.metrosafety.co.uk

Company Registration No: 03357802 VAT No: 364104228
Registered Office Address: 2 Dominus Way, Meridian Business Park, Leicester LE19 1RP



APPENDIX B Weekly fire alarm test - 07 Apr 2026

Original Metro certificate - page 2 of 2



Visit Report

Fire Alarm Test

00948915 - Tue, 7 Apr 26 10:09 AM

Tested Asset/s

Asset	Location	Result
Fire Alarm Panel	Common area, ground floor, rear entrance lobby, RHS wall, LHS Panel FAP1	☒
Call Point	Basement 1 Common Area Lift Lobby Landing CP BA	☒

T 020 7960 3939 E enquiries@metrosafety.co.uk W www.metrosafety.co.uk

Company Registration No: 03557802 VAT No: 364104228
Registered Office Address: 2 Dominus Way, Meridian Business Park, Leicester LE19 9P



APPENDIX B Weekly fire alarm test - 14 Apr 2026

Original Metro certificate - page 1 of 2



Visit Report

Fire Alarm Test

00948916 - Tue, 14 Apr 26 10:06 AM

Address
Visit Date
Work Order Number
Inspector
Building Reference

Velocity Tower, 10 St Mary's Gate, Sheffield, S1 4LR
Tue, 14 Apr 26 10:06 AM
00948916
Mr Fisher
Metro: 103352

Survey Results – No Action Required

Question	Result
The Fire Alarm Panel was showing no fault lights and a healthy power supply.	✓
The Break Glass Unit due to be tested was showing no visible signs of damage.	✓
The sounders activated upon testing of the Break Glass Unit.	✓
The correct zone or loop was displayed on the fire panel.	✓
Interfaced panels or systems (i.e. lifts, gas supply) acted in accordance with the correct cause and effect.	✓
The Alarm receiving centre received a fire signal.	✓
The fire panel silenced and reset correctly and was left with no fault lights present.	✓
Any interfaced systems were reset and left in working order.	✓

New Issues Detected

No New Issues.

New Issues Images

Case No.	Image
----------	-------

Existing Cases Redetected

Question	Case No.	Location	Subject	Issue Description	Next Action
----------	----------	----------	---------	-------------------	-------------


No Existing Issues.

Existing Cases Images

Case No.	Image
----------	-------

T 020 7960 3939 E enquiries@metrosafety.co.uk W www.metrosafety.co.uk

Company Registration No: 03357802 VAT No: 364104228
Registered Office Address: 2 Dominus Way, Meridian Business Park, Leicester LE19 1RP



APPENDIX B Weekly fire alarm test - 14 Apr 2026

Original Metro certificate - page 2 of 2



Visit Report

Fire Alarm Test

00948916 - Tue, 14 Apr 26 10:06 AM

Tested Asset/s

Asset	Location	Result
Fire Alarm Panel	Common area, ground floor, rear entrance lobby, RHS wall, LHS Panel FAP1	✓
Call Point	Basement 2 Common Area Stair Landing LHS Wall CP BC	✓

T 020 7960 3939 E enquiries@metrosafety.co.uk W www.metrosafety.co.uk

Company Registration No: 03557802 VAT No: 364104228
Registered Office Address: 2 Dominus Way, Meridian Business Park, Leicester LE19 9P



APPENDIX B Weekly fire alarm test - 23 Apr 2026

Original Metro certificate - page 1 of 2



Visit Report

Fire Alarm Test

00948917 - Thu, 23 Apr 26 10:13 AM

Address
Visit Date
Work Order Number
Inspector
Building Reference

Velocity Tower, 10 St Mary's Gate, Sheffield, S1 4LR
Thu, 23 Apr 26 10:13 AM
00948917
Mr Wilson
Metro: 103352

Survey Results – No Action Required

Question	Result
The Fire Alarm Panel was showing no fault lights and a healthy power supply.	✓
The Break Glass Unit due to be tested was showing no visible signs of damage.	✓
The sounders activated upon testing of the Break Glass Unit.	✓
The correct zone or loop was displayed on the fire panel.	✓
Interfaced panels or systems (i.e. lifts, gas supply) acted in accordance with the correct cause and effect.	✓
The Alarm receiving centre received a fire signal.	✓
The fire panel silenced and reset correctly and was left with no fault lights present.	✓
Any interfaced systems were reset and left in working order.	✓

New Issues Detected

No New Issues.

New Issues Images

Case No.	Image
----------	-------

Existing Cases Redetected

Question	Case No.	Location	Subject	Issue Description	Next Action
----------	----------	----------	---------	-------------------	-------------


No Existing Issues.

Existing Cases Images

Case No.	Image
----------	-------

T 020 7960 3939 E enquiries@metrosafety.co.uk W www.metrosafety.co.uk

Company Registration No: 03557802 VAT No: 364104228
Registered Office Address: 2 Dominus Way, Meridian Business Park, Leicester LE19 1RP



APPENDIX B Weekly fire alarm test - 23 Apr 2026

Original Metro certificate - page 2 of 2



Visit Report

Fire Alarm Test

00948917 - Thu, 23 Apr 26 10:13 AM

Tested Asset/s

Asset	Location	Result
Fire Alarm Panel	Common area, ground floor, rear entrance lobby, RHS wall, LHS Panel FAP1	✓
Call Point	Common area, ground floor, small meeting room behind reception, LHS Wall CP GD	✓

T 020 7960 3939 E enquiries@metrosafety.co.uk W www.metrosafety.co.uk

Company Registration No: 03557802 VAT No: 364104228
Registered Office Address: 2 Dominus Way, Meridian Business Park, Leicester LE19 9PF

